

SUMMARY A2 Highway Belmont , Bluefields, Westmoreland Parish 00000 Client Name Redacted November 24, 2024

This is only a summary of some of the physical deficiencies found during the inspection. Items highlighted in orange and red are most crucial in the opinion of the inspector. It is recommended the full report be reviewed to observe more details regarding other defects and physical deficiencies.



MINOR CONCERNS



MODERATE CONCERNS


Moderate Concerns



MAJOR SAFETY HAZARD

1.2.1 Coastline Property

CRACKING & PEELING (EXTERIOR PAINT)

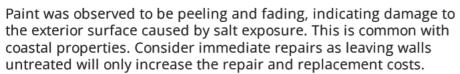

Recommendation

Contact a qualified mareino developers jamaica



1.2.2 Coastline Property

CORRODING METAL SURFACES



Rust and corrosion was observed on metal railings, window frames, hinges, doors, etc., all across the property. This is common with coastal properties. The corrosion prevented in some instances the proper operation of elements of the property including but not limited to doors and windows. Recommend removal of rust and coating with anti rust sealant/paint.

Recommendation

Contact a qualified professional.





2.1.1 Walls **REBAR EXPANSION**



Crack appears to be caused by rebar corrosion which caused the reinforced bars to expand Recommendation Contact a qualified general contractor.





Lobby

2.1.2 Walls MOISTURE INTRUSION



Water leaking causing mold growth. Water came through concrete. Recommend water proofing roof.

Recommendation

Contact a qualified professional.

Mareino Developers Jamaica Page 2 of 44







Lobby

Lobby

2.2.1 Bathroom

TOILET & BASIN



The toilet and basin needs to be repaired along with the plumbing of the pressure piping. The grab bar for disabled persons is not installed at the correct height.

Recommendation Contact a qualified professional.







Lobby Bathroom

Lobby Bathroom

Lobby Bathroom


2.3.1 Office

LOOSE WIRES



Loose wires can become a shock or fire hazard and should be corrected.

Recommendation Contact a qualified professional.

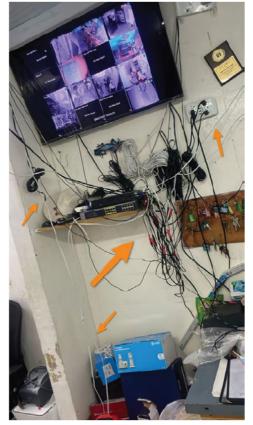

2.3.2 Office

DOOR JAMB



While only a cosmetic defect, the client should note the need for stripping, sanding and repainting of door jambs, walls, etc.,

Recommendation

Contact a qualified professional.



3.1.1 Mold, Moisture & Odor **MOLD PRESENT**



Excessive moisture intrusion in the store room was observed to cause black mold to form on the ceiling. This is very unsafe for storing food items.

Recommendation Contact a qualified professional.



3.1.2 Mold, Moisture & Odor

STRONG ODOR



The client reported a strong odor in the lobby/office area. Upon investigation, the smell appeared to be caused by meat stored in a defective freezer that is rotting. The freezer appears to have lost seal and so cannot preserve the contents placed inside. Replacement recommended



Minor Concerns

4.1.1 Coverings

AVERAGE WEAR

The roofing material was showing average wear and should be monitored. Roofing material of this age will require higher maintenance.


Moderate Concerns

Recommendation

Contact a qualified roofing professional.

4.1.2 Coverings

MOSS / STAINING

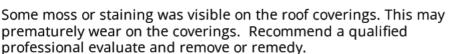

Recommendation

Contact a qualified cleaning service.



Main Roof

4.1.3 Coverings

LIFTED ROOF COVER

The metal sheeting has lifted in some area which could lead to moisture intrusion. Recommend a qualified roofing contractor repair fault.

Recommendation

Contact a qualified roofing professional.



4.2.1 Roof Drainage Systems

DEBRIS

Debris has accumulated in the drainage system. Recommend cleaning to facilitate water flow. This blockage might be related to the water intrusion observed in the lobby area.

Recommendation

Recommended DIY Project








Minor Concerns

4.2.2 Roof Drainage Systems

DOWNSPOUT DAMAGED

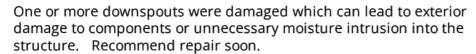

Recommendation Contact a qualified professional.



5.1.1 Decks & Balconies

WATER SEALANT REQUIRED



Components were showing signs of weathering and/or minor water damage. Recommend sanding, water sealant / weatherproofing be applied.

Recommendation

Contact a qualified mareino developers jamaica





Poolside deck

5.1.2 Decks & Balconies

DAMAGED COMPONENTS



Some of the components on the pool deck require maintenance repairs and weatherproofing. Some component replacement may be needed.

Recommendation Contact a qualified general contractor.





Mareino Developers Jamaica Page 7 of 44


5.1.3 Decks & Balconies

DAMAGED FLOORING



One or more portions of the flooring were observed to have minor damage or deterioration.. Recommend repair..

Recommendation Contact a qualified mareino developers jamaica

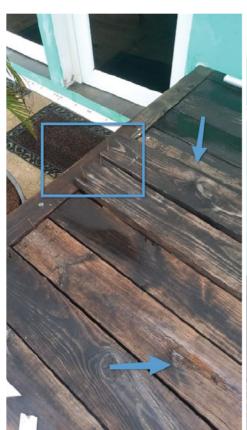



5.1.4 Decks & Balconies

RAILING UNSAFE



There was an unsafe or loose railing. Railings should be secure and be 42" minimum in height.

Recommendation

Contact a qualified handyman.



DAMAGED STEPS




The steep leading to the Cottage deck is damaged. Recommend qualified contractor evaluate & repair for continuous use. Replacement maybe necessary.

Recommendation

Contact a qualified mareino developers jamaica



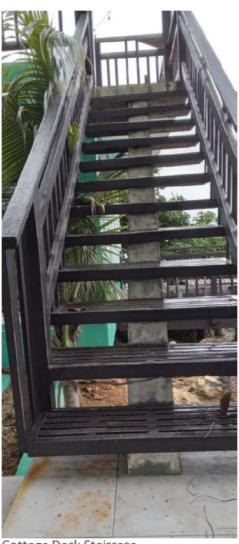

Cottage Deck Staircase

5.3.1 Exterior Doors and Windows

PAINTING / SEALING



Recommend a qualified contractor evaluate and paint or seal to preserve the life of the material and minimize the potential for moisture intrusion.

Recommendation

Contact a qualified painting contractor.



Cottage

5.3.2 Exterior Doors and Windows

CAULK MAINTENANCE



Caulk maintenance is recommended around all window and door flashings or trim where the potential for moisture intrusion may occur. This is an ongoing maintenance repair.

Recommendation Contact a handyman or DIY project



5.3.3 Exterior Doors and Windows

DOOR HARDWARE



The door would not close or latch properly. Recommend qualified handyman adjust or replace hardware.

Recommendation

Contact a qualified mareino developers jamaica







5.4.1 Exterior Vent (Kitchen)

FAN MAINTENANCE

KITCHEN

Recommend fan maintenance.

Recommendation

Contact a qualified professional.





5.5.1 Wood Railings **DAMAGED**

Requires repair.

Recommendation Contact a qualified professional.





6.1.1 Doors & Windows **DOOR HARDWARE**



BEDROOMS

Door hardware requires maintenance. The hardware should be adjusted, oiled, or replaced. Recommend repair by contractor.

Recommendation

Contact a qualified mareino developers jamaica



6.1.2 Doors & Windows

DOOR STICKS



Door sticks and is tough to open. Recommend sanding down offending sides or adjustments as needed.

Recommendation

Contact a qualified mareino developers jamaica



6.3.1 Walls and Ceilings

MINOR CRACKS/DAMAGE



Minor cracks or localized damage in the walls or ceiling was noted. Some settling is not unusual in a building of this age and these cracks are not a structural concern. Any localized damage or imperfections should be patched and monitored.

Recommendation

Contact a qualified mareino developers jamaica



6.3.2 Walls and Ceilings

GHOSTING EVIDENT



The buildup of ghost marks can be caused by any combination of moisture, cold spots, static electricity, air currents, and a supply of dust, soot, and other particulates that can drift with the air. Cold spots on walls and ceilings get damp from condensation, and airborne dust clings to the dampness.



I recommend an insulation and ventilation specialist evaluate further for modifications. After modifications, I recommend consulting a professional for painting.

Recommendation
Contact a qualified insulation contractor.

6.3.3 Walls and Ceilings

POOR PATCHING



Sub-standard plaster patching of walls observed at time of inspection. Recommend proper resurfacing of all walls.

Recommendation

Contact a qualified mareino developers jamaica

6.3.4 Walls and Ceilings

CRACKED MASONRY



Some of the concrete or masonry components were cracked. Recommend a qualified contractor evaluate and repair properly.

Recommendation

Contact a qualified general contractor.



6.3.5 Walls and Ceilings **STAIN(S)**



There are stains on ceiling/wall that requires repair and paint. Source of staining should be determined and repaired prior.

Recommendation
Contact a qualified mareino developers jamaica



6.3.6 Walls and Ceilings

WATER DAMAGE



Stains and water damaged materials on the wall and window sill appeared to be the result of previous moisture intrusion. The source of leakage should be identified and corrected, and the area repaired. Hidden defects may be present behind the material. Damp proofing recommended

Recommendation

Contact a qualified general contractor.



Bedrooms



Bathroom

6.3.7 Walls and Ceilings

MOLD GROWTH



Multiple mold growth observed on walls due to moisture intrusion. Cleaning and treatment required.

Recommendation

Contact a qualified professional.



Bedroom



Bedroom Ceiling



Bathroom



7.1.1 Vegetation, Grading, & General Site **STANDING WATER**



Very little standing water was observed in one or more areas at the front of the property after light rain which could indicate poor drainage and/or grading. Recommend monitor.

Recommendation Contact a qualified grading contractor.



7.1.2 Vegetation, Grading, & General Site **VEGETATION**



Vegetation was noted to be in close proximity of the structure. Recommend trimming or removing to avoid unnecessary damage or moisture intrusion.

Recommendation
Contact a qualified landscaping contractor



Front of Building

7.2.1 Walkways & Driveways

GRAVEL / DIRT DRIVEWAYS



Gravel and dirt driveways or walkways require ongoing maintenance, backfill, and leveling. Anticipate a higher level of maintenance.

Recommendation

Contact a qualified driveway contractor.

8.1.1 Doors & Windows

DOOR HARDWARE



Door hardware requires maintenance. The hardware should be adjusted, lubed, or replaced. Recommend repair.


Recommendation

Contact a qualified mareino developers jamaica

8.2.1 Floors, Walls, and Ceilings

TILES DAMAGED

KITCHEN

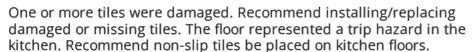

Recommendation

Contact a qualified tile contractor



8.2.2 Floors, Walls, and Ceilings

GROUT DETERIORATING

BATHROOMS

Grout lines were cracked or severely deteriorated. Recommend a qualified contractor repair or replace grout.




Moderate Concerns



8.2.3 Floors, Walls, and Ceilings

STAIN(S)

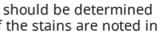

Minor Concerns

There is a stain on ceiling/wall that requires repair and paint. Source of staining should be determined and repaired prior to cosmetic repairs. Additional ventilation may be necessary if the stains are noted in the shower area.

Recommendation

Contact a qualified mareino developers jamaica

8.2.4 Floors, Walls, and Ceilings

FALL HAZARD

KITCHEN



The floor (tiles) represented a trip hazard in one or more areas. Recommend installing non-slip tiles in kitchen.

Minor Concerns

Recommendation

Contact a qualified professional.

8.3.1 Plumbing Related

CAULK MAINTENANCE




Recommendation

Contact a handyman or DIY project



8.3.2 Plumbing Related

RECOMMEND SHUT-OFF VALVES

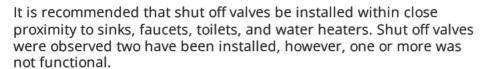

Recommendation

Contact a qualified plumbing contractor.



8.3.3 Plumbing Related

PLUMBING LEAK



Moderate Concerns

A plumbing leak was noted in one or more of the Bathrooms which may cause moisture damage to surrounding materials. Recommend repair prior to use.

Recommendation

Contact a qualified plumbing contractor.

TUB / SHOWER ENCLOSURE REPAIR



The shower or tub surround showed some damage. Recommend Repair or replacement as needed to avoid moisture intrusion behind the walls.

Recommendation Contact a handyman or DIY project







9.2.1 Foundation Walls

PERIMETER WALL



The perimeter wall in the bar area needs to be extended and repaired. Signs of corrosion on the rebars and soil erosion present. Early correction can prevent more extensive and expensive repairs.

Recommendation

Contact a qualified professional.





10.1.1 Service Entrance Conductors

METER RUSTED

Rust was observed on the exterior cover of the meter panel. Not a significant issue however cleaning and coating the meter in rust proof paint can extend life of panel.

Recommendation Contact a qualified electrical contractor.



10.1.2 Service Entrance Conductors

TREE BRANCHES



Tree branches should be cut back from utility line.

Recommendation Contact your local utility company



10.1.3 Service Entrance Conductors

ABANDONED WIRING

Recommend removal by licensed electrician

Recommendation

Contact a qualified professional.





10.2.1 Main & Subpanels **MISSING LABELS**



At the time of inspection, the main panel, sub main in the Cottage and Bar had no labels to identify and differentiate breakers. Recommend a qualified electrician identify and map out locations to verify.

Recommendation

Contact a qualified pink electric





No labels cottage

No labels Bar

10.2.2 Main & Subpanels

IMPROPER WIRING METHODS



Some sloppy or improper wiring methods were noted running to and from the panel. Wire nuts or crowded wiring is not recommended. This can be a fire hazard.

Recommendation

Contact a qualified electrical contractor.



Sloppy wiring to main


10.2.3 Main & Subpanels PANEL COVER MISSING



The panel cover was missing on main panel in lobby area. Recommend installation soon.

Recommendation

Contact a qualified electrical contractor.

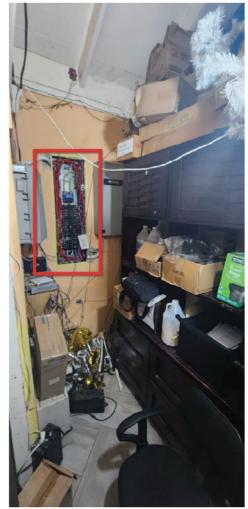


No cover

10.2.4 Main & Subpanels

PANEL MAXED OUT

The panel had no more space for additional circuits. Recommend exploring options for a sub-panel or upgrade service with a larger panel.

Recommendation Contact a qualified pink electric

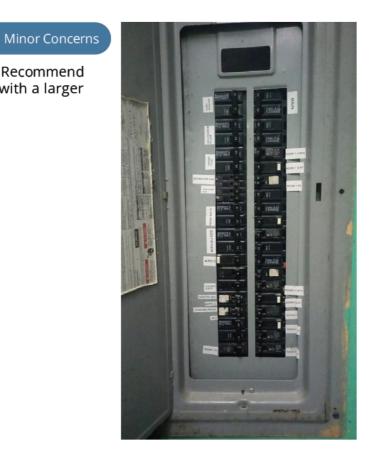

GFCI BREAKERS



Minimal or no GFCI (Ground Fault Circuit Interrupter) breakers were noted in the main or sub main panels. Recommend a licensed electrician evaluate and remedy as needed.


Recommendation

Contact a qualified electrical contractor.




10.2.6 Main & Subpanels

IMPROPER LOCATION

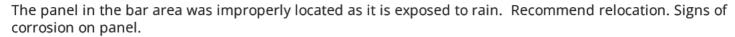

Recommendation

Contact a qualified professional.

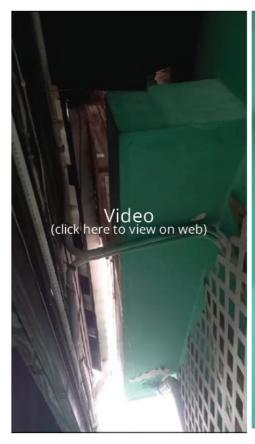



10.3.1 Branch Wiring Circuits **DAMAGED COMPONENTS**



Any damaged or corroded electrical components should be repaired or replaced by a licensed electrician.

Recommendation
Contact a qualified pink electric



10.3.2 Branch Wiring Circuits

ABANDONED WIRING



Some apparent abandoned wiring was noted. Recommend a licensed electrician remove.

Recommendation

Contact a qualified electrical contractor.

10.4.1 Lighting, Fans, Switches, & Receptacles

AGED COMPONENTS



Some of the electrical components appeared aged. These components and their connections can become brittle over time. Updating of any older outlets, switches, or fixtures should be explored.

Recommendation

Contact a qualified pink electric





Lights in rooms/exterior

Exterior Light

10.4.2 Lighting, Fans, Switches, & Receptacles **LOOSE COMPONENTS**



All loose components, especially wires should be repaired and secured prior to use.

Recommendation Contact a qualified pink electric





10.4.3 Lighting, Fans, Switches, & Receptacles **DAMAGED COMPONENTS**





All damaged or corroded electrical components should be repaired or replaced by a licensed electrician.

Recommendation Contact a qualified pink electric








Bar Outlet Cabin

10.4.4 Lighting, Fans, Switches, & Receptacles **IMPROPER WIRING**



Multiple loose and exposed wiring was observed. This should be modified for improved safety. Securing wires and adding junction boxes as needed is recommended. Recommend a licensed electrician evaluate and repair properly immediately. This is a Fire hazard.

Contact a qualified electrical contractor.

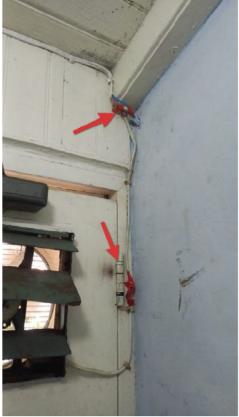





Kitchen Exhaust Fan

Storage Room

Below Pool Deck



Pump (Pool)

10.4.5 Lighting, Fans, Switches, & Receptacles **LIGHT INOPERABLE**

One or more lights were not operating. New light bulb or switch possibly needed.

Recommendation Contact a handyman or DIY project



10.4.6 Lighting, Fans, Switches, & Receptacles

COVER PLATE REPAIR



One or more junction boxes, receptacles, or switches were missing a cover plate or cover plate is damaged. This causes short and shock risk. Any junction boxes should have cover plates as well. Recommend installation of plates.

Recommendation Contact a qualified pink electric



10.4.7 Lighting, Fans, Switches, & Receptacles




OPEN GROUND

One or more receptacles had been wired with an open ground. This can create a shock hazard. Recommend licensed electrician evaluate & repair.

Recommendation

Contact a qualified electrical contractor.

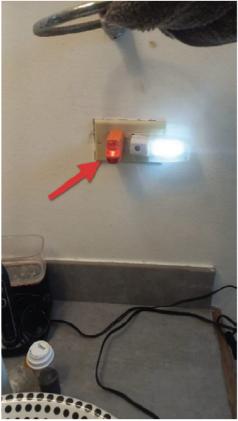

Cottage

10.4.8 Lighting, Fans, Switches, & Receptacles



OUTLET INOPERABLE

One or more outlets were inoperable. Recommend a licensed electrician evaluate further and replace.

Recommendation

Contact a qualified electrical contractor.



Cottage

10.4.9 Lighting, Fans, Switches, & Receptacles





The outlet location was improper and may inadvertently cause a hazard. Ceiling mounted or side cabinet outlets should be relocated. Recommend relocation of the circuit and outlet.

Recommendation

Contact a qualified electrical contractor.



10.4.10 Lighting, Fans, Switches, & Receptacles



Major Safety Hazard

GFCI FAULTY

The GFCI was not tripping properly. Recommend repair or replacement of all GFCI plugs on the property.

Recommendation

Contact a qualified pink electric



Bar Bathroom

10.4.11 Lighting, Fans, Switches, & Receptacles





No GFCI protection was present in some locations. GFCI's are recommended in kitchens, baths, garages, and exterior applications. Recommend licensed electrician upgrade by installing ground fault receptacles in all necessary locations.

Here is a link to read about how GFCI receptacles keep you safe.

Recommendation Contact a qualified electrical contractor.





Bar Sink

10.4.12 Lighting, Fans, Switches, & Receptacles



FAN REPAIR

The fans were either noisy or wobbly. Recommend repair or replacement prior to use in all bedrooms

Recommendation

Contact a qualified electrical contractor.



Bedrooms

10.4.13 Lighting, Fans, Switches, & Receptacles

FAN INOPERABLE



One or more fans were inoperable. Recommend a licensed electrician evaluate further.

Recommendation

Contact a qualified pink electric

10.4.14 Lighting, Fans, Switches, & Receptacles

WATERPROOF COVERS



Multiple outlets in the Bar area needs waterproof covers to prevent moisture intrusion which can cause fire or short circuit.

Recommendation

Contact a qualified professional.







Bar Balcony

Cabin Deck

10.5.1 Generator/Transfer Switch

UNCOVERED EQUIPMENT



While the generator has an outer protective casing to protect the engine, etc., there is need for a cover over the generator to protect from the elements and salt.

Recommendation Recommended DIY Project



10.5.2 Generator/Transfer Switch

UNSECURED EQUIPMENT



I would recommend building a metal cage encasement that can be locked so that access can be controlled.

Recommendation

Contact a qualified professional.



11.1.1 Water Heater(s)

ANNUAL MAINTENANCE



Water heaters should be flushed annually to prevent sediment buildup and maintain efficiency. Burner chambers should also be serviced and cleaned. Recommend a qualified plumber service and flush. There was no evidence of yearly maintenance. Immediate cleaning recommended.


Minor Concerns

Recommendation

Contact a qualified plumbing contractor.

11.1.2 Water Heater(s)

AGED UNIT

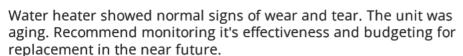

Recommendation

Contact a qualified plumbing contractor.



11.1.3 Water Heater(s)

IMPROPER INSTALLATION



All Water heaters were improperly installed. Recommend qualified plumber evaluate & repair. Copper pipes should be used for header lines with lines running to each unit from that single header line to supply each heater instead of PVC.

Recommendation

Contact a qualified plumbing contractor.






Bank of Four

11.1.4 Water Heater(s)

INCORRECT PIPING

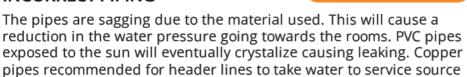

Recommendation Contact a qualified professional.

where PVC can then be used.



Sagging Lines

11.2.1 Water Supply & Distribution Systems

MARGINAL PRESSURE



Some fixtures showed marginal supply pressure with multiple fixtures operating at the same time. The water pressure system needs to be replaced and replumbed for efficiency and effectiveness.

Recommendation
Contact a qualified plumbing contractor.






11.2.2 Water Supply & Distribution Systems **INSULATION RECOMMENDED**



It is recommended the pipes be insulated for efficiency and to reduce the risk of crystalizing.

Recommendation
Contact a qualified mareino developers jamaica

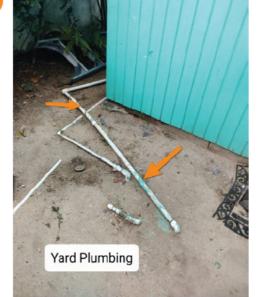

11.2.3 Water Supply & Distribution Systems **IMPROPER INSTALLATION**



Distribution pipes or components were installed in a sub-standard way. The pressure plumbing bath is hot and cold. I recommend pipes and components be replumbed and repaired to meet current construction standards.


Recommendation

Contact a qualified plumbing contractor.



11.3.1 Sewage Systems

GRAY WATER

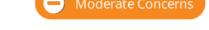

The gray water system in the main kitchen is inaccessible. This is a cause for concern as regular checks will be impossible.

Recommendation

Contact a qualified plumbing contractor.

11.3.2 Sewage Systems

SEPTIC SYSTEM




Septic tank needs to be emptied, cleaned and fitted with heavy duty covers. The sewage holding tank also needs to be emptied and cleaned. Recommend construction of a new top and steel cover

Recommendation

Contact a qualified professional.





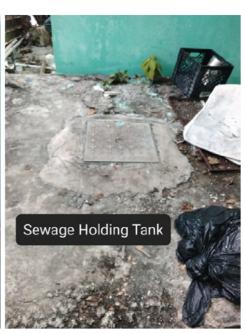

11.3.3 Sewage Systems **GULLY BASIN**



Major Safety Hazard

Side view gully basin is inaccessible. recommend correcting.


Recommendation

Contact a qualified mareino developers jamaica



11.3.4 Sewage Systems

INCORRECT INSTALLATION (LAUNDRY)

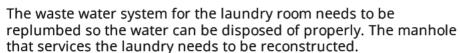

Recommendation Contact a qualified professional.



11.3.5 Sewage Systems

IMPROPER DISPOSAL (KITCHEN)



The waste water from the bare and kitchen sink needs to be disposed of properly. Open pipe running to the sea is not recommended. The plumbing for the kitchen sink is faulty and needs replacement.

Recommendation

Contact a qualified professional.





11.3.6 Sewage Systems INADEQUATE MANHOLE COVERS



Recommend replacing aluminum man hole covers in the driveway way with iron/steel covers. Aluminum covers cannot withstand the weight of vehicular traffic and can break.

Recommendation Contact a qualified professional.



12.2.1 Cooling Equipment

INSULATION DAMAGED



Missing or damaged insulation on refrigerant line can cause energy loss and condensation.

Recommendation Contact a qualified pink electric





12.2.2 Cooling Equipment

INOPERABLE



The cooling unit (Fan and AC) was inoperable at time of inspection in room #6. Fan inoperable in bedroom 5. Recommend a qualified HVAC professional evaluate & ensure functionality.

Recommendation
Contact a qualified HVAC professional.





Room 6 AC

12.2.3 Cooling Equipment



IMPROPER INSTALLATION

AC Unit operational in apartment #9 & 4 however switch was bypassed. This means direct current is flowing to AC Units with no regulator.

Recommendation

Contact a qualified pink electric





Apartment 9

Apartment 4

14.2.1 Signage & Lighting

EXTERIOR SIGNAGE



Better signage is recommended for the property on the exterior to denote the address, entryways, exits, and parking.

Recommendation

Contact a qualified professional.

14.2.2 Signage & Lighting

EXIT SIGNS



Recommend placing updated exit signs in appropriate places throughout the property.

Recommendation

Contact a qualified professional.

14.2.3 Signage & Lighting

NO SMOKING SIGNS



Recommend placing updated no smoking signs in appropriate places throughout the property.

Recommendation

Contact a qualified professional.

14.2.4 Signage & Lighting

CAUTION SIGNAGE



Recommend placing caution signs throughout the property where needed. The caution signs could include: flammable, fall hazard, wet floor, combustible. No Life guard on duty, etc..

Recommendation

Contact a qualified professional.

14.2.5 Signage & Lighting

EXIT LIGHTING



Recommend installing exit or emergency lighting where applicable. Ongoing testing of this equipment is recommended.

Recommendation

Contact a qualified professional.

14.3.1 Fire Safety


AGED DETECTOR



The age of the detectors observed could not be ascertained nor the battery type noted. Recommend replacement with a 10 year sealed battery style or a hardwired system once age is determined and has passed 10 years since installed.

Recommendation

Contact a qualified mareino developers jamaica

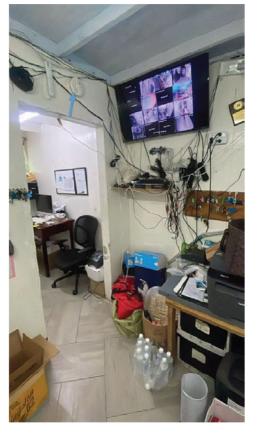

14.3.2 Fire Safety

MISSING DETECTORS



Some missing detectors were noted. Smoke detectors should be installed in every living space and a minimum of one CO detector per floor should be installed.

Recommendation

Contact a qualified electrical contractor.



14.3.3 Fire Safety **ALARM SYSTEM**



The alarm system was not tested. Recommend a qualified professional test the system prior to settlement of the property.

Recommendation Contact a qualified professional.